

## Baseline Assessment – Stream Attributes

### Reach S-CD16 (Timber Mat Crossing) Intermittent Spread B Lewis County, West Virginia

Data	Included
Photos	✓
SWVM Form	✓
FCI Calculator and HGM Form	N/A – slope <4%
RBP Physical Characteristics Form	✓
Water Quality Data	✓
RBP Habitat Form	✓
RBP Benthic Form	✓
Benthic Identification Sheet	N/A – Lack of habitat
Wolman Pebble Count	✓
Reference Reach Software Pebble Count Data	✓
Longitudinal Profile and Cross Sections	✓

## Spread B Stream S-CD16 (Timber Mat Crossing) Lewis County



Photo Type: DS, US View

Location, Orientation, Photographer Initials: Downstream Edge of ROW, Upstream View, AJE/PEL

Lat: 38.904135 Long: -80.563719



Photo Type: DS, DS View

Location, Orientation, Photographer Initials: Downstream Edge of ROW, Downstream View, AJE/PEL

Lat: 38.904135 Long: -80.563719



## Spread B Stream S-CD16 (Timber Mat Crossing) Lewis County



Photo Type: US View at Center  
Location, Orientation, Photographer Initials: Center ROW, Upstream View, AJE/PEL  
Lat: 38.904135 Long: -80.563719

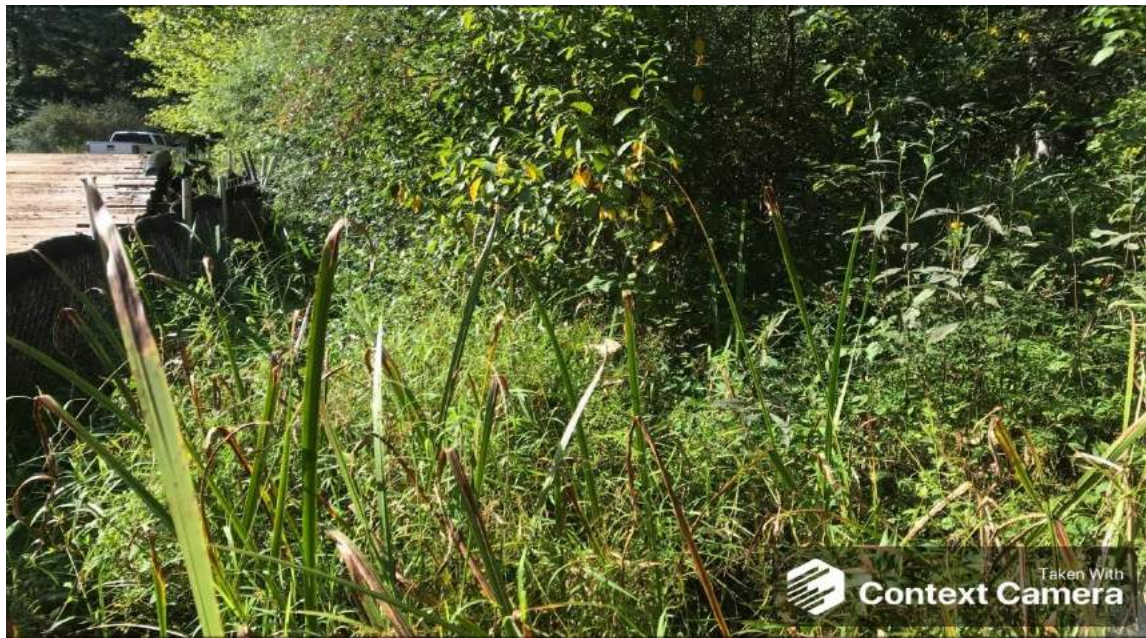


Photo Type: DS View at Center  
Location, Orientation, Photographer Initials: ROW Center, Downstream View, AJE/PEL  
Lat: 38.904135 Long: -80.563719



## Spread B Stream S-CD16 (Timber Mat Crossing) Lewis County



Photo Type: US, US View

Location, Orientation, Photographer Initials: Upstream Edge of ROW, Upstream View, AJE/PEL

Lat: 38.904135 Long: -80.563719



Photo Type: US, DS View

Location, Orientation, Photographer Initials: Upstream Edge of ROW, Downstream View, AJE/PEL

Lat: 38.904135 Long: -80.563719



## Spread B Stream S-CD16 (Timber Mat Crossing) Lewis County



Photo Type: Riffle, DS View  
Location, Orientation, Photographer Initials: Upstream of Riffle, Downstream View, AJE/PEL  
Lat: 38.904135 Long: -80.563719



Photo Type: Riffle, US View  
Location, Orientation, Photographer Initials: Downstream of Riffle, Upstream View, AJE/PEL  
Lat: 38.904135 Long: -80.563719



## Spread B Stream S-CD16 (Timber Mat Crossing) Lewis County



Photo Type: Pool, DS View  
Location, Orientation, Photographer Initials: Upstream of Pool, Downstream View, AJE/PEL  
Lat: 38.904135 Long: -80.563719

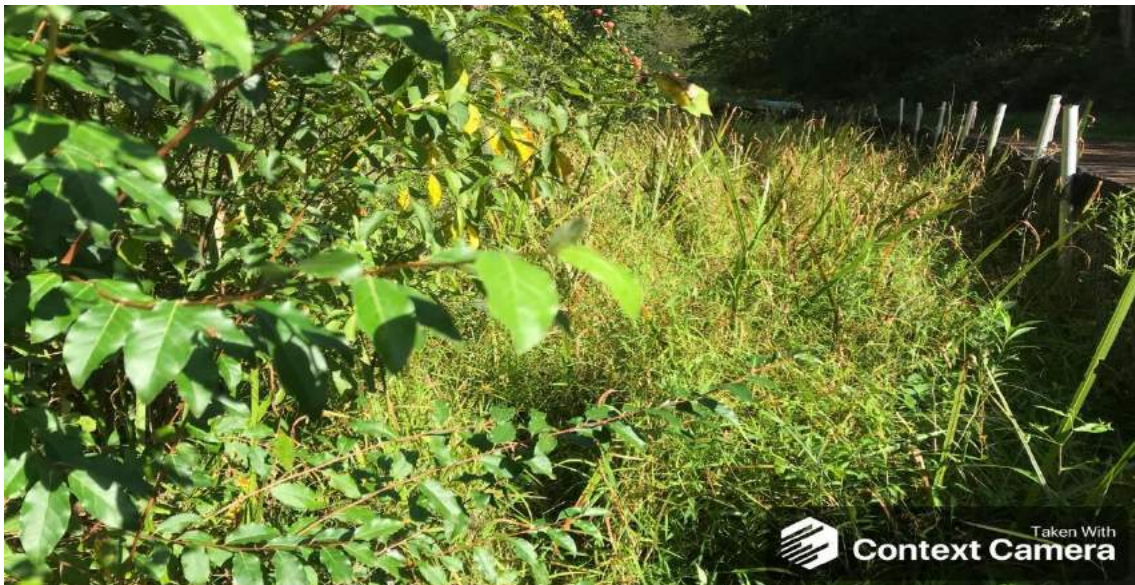


Photo Type: Pool, US View  
Location, Orientation, Photographer Initials: Downstream of Pool, Upstream View, AJE/PEL  
Lat: 38.904135 Long: -80.563719

USACE FILE NO./ Project Name: (v2.1, Sept 2016)		Mountain Valley Pipeline		IMPACT COORDINATES: (in Decimal Degrees)		Lat.	38.904135	Lon.	-80.563719	WEATHER:		Showers	DATE:		09/02/21		
IMPACT STREAM/SITE ID AND SITE DESCRIPTION: (watershed size (acres), unaltered or impairments)				S-CD16		MITIGATION STREAM CLASS./SITE ID AND SITE DESCRIPTION: (watershed size (acres), unaltered or impairments)						Comments:					
STREAM IMPACT LENGTH:		1.9	FORM OF MITIGATION:		RESTORATION (Levels I-III)		MIT COORDINATES: (in Decimal Degrees)		Lat.		Lon.		PRECIPITATION PAST 48 HRS:		Mitigation Length:		
Column No. 1- Impact Existing Condition (Debit)			Column No. 2- Mitigation Existing Condition - Baseline (Credit)			Column No. 3- Mitigation Projected at Five Years Post Completion (Credit)			Column No. 4- Mitigation Projected at Ten Years Post Completion (Credit)			Column No. 5- Mitigation Projected at Maturity (Credit)					
Stream Classification:			Intermittent			Stream Classification:			0			Stream Classification:			0		
Percent Stream Channel Slope			2			Percent Stream Channel Slope			0			Percent Stream Channel Slope			0		
HGM Score (attach data forms):						HGM Score (attach data forms):						HGM Score (attach data forms):					
Average						Average						Average					
Hydrology						Hydrology						Hydrology					
Biogeochemical Cycling						Biogeochemical Cycling						Biogeochemical Cycling					
Habitat						Habitat						Habitat					
PART I - Physical, Chemical and Biological Indicators						PART I - Physical, Chemical and Biological Indicators						PART I - Physical, Chemical and Biological Indicators					
Points Scale			Range			Points Scale			Range			Points Scale			Range		
Site Score						Site Score						Site Score					
PHYSICAL INDICATOR (Applies to all streams classifications)						PHYSICAL INDICATOR (Applies to all streams classifications)						PHYSICAL INDICATOR (Applies to all streams classifications)					
USEPA RBP (High Gradient Data Sheet)						USEPA RBP (High Gradient Data Sheet)						USEPA RBP (High Gradient Data Sheet)					
1. Epifaunal Substrate/Available Cover			0-20			1. Epifaunal Substrate/Available Cover			0-20			1. Epifaunal Substrate/Available Cover			0-20		
2. Embeddedness			0-20			2. Embeddedness			0-20			2. Embeddedness			0-20		
3. Velocity/ Depth Regime			0-20			3. Velocity/ Depth Regime			0-20			3. Velocity/ Depth Regime			0-20		
4. Sediment Deposition			0-20			4. Sediment Deposition			0-20			4. Sediment Deposition			0-20		
5. Channel Flow Status			0-20			5. Channel Flow Status			0-20			5. Channel Flow Status			0-20		
6. Channel Alteration			0-20			6. Channel Alteration			0-20			6. Channel Alteration			0-20		
7. Frequency of Riffles (or bends)			0-20			7. Frequency of Riffles (or bends)			0-20			7. Frequency of Riffles (or bends)			0-20		
8. Bank Stability (LB & RB)			0-20			8. Bank Stability (LB & RB)			0-20			8. Bank Stability (LB & RB)			0-20		
9. Vegetative Protection (LB & RB)			0-20			9. Vegetative Protection (LB & RB)			0-20			9. Vegetative Protection (LB & RB)			0-20		
10. Riparian Vegetative Zone Width (LB & RB)			0-20			10. Riparian Vegetative Zone Width (LB & RB)			0-20			10. Riparian Vegetative Zone Width (LB & RB)			0-20		
Total RBP Score			Suboptimal			Total RBP Score			Poor			Total RBP Score			Poor		
Sub-Total			0.71			Sub-Total			0			Sub-Total			0		
CHEMICAL INDICATOR (Applies to Intermittent and Perennial Streams)						CHEMICAL INDICATOR (Applies to Intermittent and Perennial Streams)						CHEMICAL INDICATOR (Applies to Intermittent and Perennial Streams)					
WVDEP Water Quality Indicators (General)						WVDEP Water Quality Indicators (General)						WVDEP Water Quality Indicators (General)					
Specific Conductivity						Specific Conductivity						Specific Conductivity					
100-199 = 85 points			0-90			100-199 = 85 points			0-90			100-199 = 85 points			0-90		
pH						pH						pH					
6.0-8.0 = 80 points			0-60			6.0-8.0 = 80 points			0-60			6.0-8.0 = 80 points			0-60		
DO						DO						DO					
>5.0 = 30 points			10-30			>5.0 = 30 points			10-30			>5.0 = 30 points			10-30		
Sub-Total			0.975			Sub-Total			0			Sub-Total			0		
BIOLOGICAL INDICATOR (Applies to Intermittent and Perennial Streams)						BIOLOGICAL INDICATOR (Applies to Intermittent and Perennial Streams)						BIOLOGICAL INDICATOR (Applies to Intermittent and Perennial Streams)					
WV Stream Condition Index (WVSCI)						WV Stream Condition Index (WVSCI)						WV Stream Condition Index (WVSCI)					
0			0-100			0			0-100			0			0-100		
Sub-Total			0			Sub-Total			0			Sub-Total			0		
PART II - Index and Unit Score						PART II - Index and Unit Score						PART II - Index and Unit Score					
Index			Linear Feet			Index			Linear Feet			Index			Linear Feet		
Unit Score						Unit Score						Unit Score					
0.843			86			0.843			86			0.843			86		
72.455						72.455						72.455					

# PHYSICAL CHARACTERIZATION/WATER QUALITY FIELD DATA SHEET (FRONT)

STREAM NAME _____	LOCATION _____	
STATION # _____ RIVERMILE _____	STREAM CLASS _____	
LAT _____ LONG _____	RIVER BASIN _____	
STORET # _____	AGENCY _____	
INVESTIGATORS _____		
FORM COMPLETED BY _____	DATE _____ TIME _____	REASON FOR SURVEY _____

<b>WEATHER CONDITIONS</b>	<div style="display: flex; justify-content: space-between;"> <div> <b>Now</b>             storm (heavy rain) _____            rain (steady rain) _____            showers (intermittent) _____            %cloud cover _____            clear/sunny _____         </div> <div> <b>Past 24 hours</b>             _____%         </div> </div>	
	<b>Has there been a heavy rain in the last 7 days?</b> Yes _____ No _____ <b>Air Temperature</b> _____ °C <b>Other</b> _____	
<b>SITE LOCATION/MAP</b>	<b>Draw a map of the site and indicate the areas sampled (or attach a photograph)</b> 	
<b>STREAM CHARACTERIZATION</b>	<div style="display: flex; justify-content: space-between;"> <div> <b>Stream Subsystem</b>            Perennial _____ Intermittent _____ Tidal _____         </div> <div> <b>Stream Type</b>            Coldwater _____ Warmwater _____         </div> </div> <div style="display: flex; justify-content: space-between; margin-top: 10px;"> <div> <b>Stream Origin</b>            Glacial _____            Non-glacial montane _____            Swamp and bog _____         </div> <div>           Spring-fed _____            Mixture of origins _____            Other _____         </div> <div> <b>Catchment Area</b> _____ km<sup>2</sup> </div> </div>	



# PHYSICAL CHARACTERIZATION/WATER QUALITY FIELD DATA SHEET (BACK)

<b>WATERSHED FEATURES</b>	<b>Predominant Surrounding Landuse</b> Forest _____ Field/Pasture _____ Agricultural _____ Residential _____ Commercial _____ Industrial _____ Other _____	<b>Local Watershed NPS Pollution</b> No evidence <input type="checkbox"/> Some potential sources Obvious sources _____ <b>Local Watershed Erosion</b> None _____ Moderate _____ Heavy _____		
<b>RIPARIAN VEGETATION (18 meter buffer)</b>	<b>Indicate the dominant type and record the dominant species present</b> Trees _____ Shrubs _____ Grasses _____ Herbaceous _____ <b>Dominant species present</b> _____			
<b>INSTREAM FEATURES</b>	<table style="width: 100%;"> <tr> <td style="width: 50%;"> <b>Estimated Reach Length</b> _____ m  <b>Estimated Stream Width</b> _____ m  <b>Sampling Reach Area</b> _____ m<sup>2</sup>  <b>Area in km<sup>2</sup> (m<sup>2</sup>x1000)</b> _____ km<sup>2</sup>  <b>Estimated Stream Depth</b> _____ m  <b>Surface Velocity (at thalweg)</b> _____ m/sec                         </td><td style="width: 50%;"> <b>Canopy Cover</b>                  Partly open _____ Partly shaded _____ Shaded _____  <b>High Water Mark</b> _____ m  <b>Proportion of Reach Represented by Stream Morphology Types</b>                  Riffle _____ % Run _____ %                  Pool _____ %  <b>Channelized</b> Yes _____ No _____  <b>Dam Present</b> Yes _____ No _____                         </td></tr> </table>		<b>Estimated Reach Length</b> _____ m <b>Estimated Stream Width</b> _____ m <b>Sampling Reach Area</b> _____ m <sup>2</sup> <b>Area in km<sup>2</sup> (m<sup>2</sup>x1000)</b> _____ km <sup>2</sup> <b>Estimated Stream Depth</b> _____ m <b>Surface Velocity (at thalweg)</b> _____ m/sec	<b>Canopy Cover</b> Partly open _____ Partly shaded _____ Shaded _____ <b>High Water Mark</b> _____ m <b>Proportion of Reach Represented by Stream Morphology Types</b> Riffle _____ % Run _____ % Pool _____ % <b>Channelized</b> Yes _____ No _____ <b>Dam Present</b> Yes _____ No _____
<b>Estimated Reach Length</b> _____ m <b>Estimated Stream Width</b> _____ m <b>Sampling Reach Area</b> _____ m <sup>2</sup> <b>Area in km<sup>2</sup> (m<sup>2</sup>x1000)</b> _____ km <sup>2</sup> <b>Estimated Stream Depth</b> _____ m <b>Surface Velocity (at thalweg)</b> _____ m/sec	<b>Canopy Cover</b> Partly open _____ Partly shaded _____ Shaded _____ <b>High Water Mark</b> _____ m <b>Proportion of Reach Represented by Stream Morphology Types</b> Riffle _____ % Run _____ % Pool _____ % <b>Channelized</b> Yes _____ No _____ <b>Dam Present</b> Yes _____ No _____			
<b>LARGE WOODY DEBRIS</b>	<b>LWD</b> _____ m <sup>2</sup> <b>Density of LWD</b> _____ m <sup>2</sup> /km <sup>2</sup> (LWD/ reach area)			
<b>AQUATIC VEGETATION</b>	<b>Indicate the dominant type and record the dominant species present</b> Rooted emergent _____ Rooted submergent _____ Rooted floating _____ Free floating _____ Floating Algae _____ Attached Algae _____ <b>Dominant species present</b> _____ <b>Portion of the reach with aquatic vegetation</b> _____ %			
<b>WATER QUALITY (DS, US)</b>	<table style="width: 100%;"> <tr> <td style="width: 50%;"> <b>Temperature</b> _____ °C  <b>Specific Conductance</b> _____  <b>Dissolved Oxygen</b> _____  <b>pH</b> _____  <b>Turbidity</b> _____  <b>WQ Instrument Used</b> _____                         </td><td style="width: 50%;"> <b>Water Odors</b>                  Normal/None _____ Sewage _____                  Petroleum _____ Chemical _____                  Fishy _____ Other _____  <b>Water Surface Oils</b>                  Slick _____ Sheen _____ Globes _____ Flecks _____                  None _____ Other _____  <b>Turbidity (if not measured)</b>                  Clear <input type="checkbox"/> Slightly turbid _____ Turbid _____                  Opaque _____ Stained _____ Other _____                         </td></tr> </table>		<b>Temperature</b> _____ °C <b>Specific Conductance</b> _____ <b>Dissolved Oxygen</b> _____ <b>pH</b> _____ <b>Turbidity</b> _____ <b>WQ Instrument Used</b> _____	<b>Water Odors</b> Normal/None _____ Sewage _____ Petroleum _____ Chemical _____ Fishy _____ Other _____ <b>Water Surface Oils</b> Slick _____ Sheen _____ Globes _____ Flecks _____ None _____ Other _____ <b>Turbidity (if not measured)</b> Clear <input type="checkbox"/> Slightly turbid _____ Turbid _____ Opaque _____ Stained _____ Other _____
<b>Temperature</b> _____ °C <b>Specific Conductance</b> _____ <b>Dissolved Oxygen</b> _____ <b>pH</b> _____ <b>Turbidity</b> _____ <b>WQ Instrument Used</b> _____	<b>Water Odors</b> Normal/None _____ Sewage _____ Petroleum _____ Chemical _____ Fishy _____ Other _____ <b>Water Surface Oils</b> Slick _____ Sheen _____ Globes _____ Flecks _____ None _____ Other _____ <b>Turbidity (if not measured)</b> Clear <input type="checkbox"/> Slightly turbid _____ Turbid _____ Opaque _____ Stained _____ Other _____			
<b>SEDIMENT/ SUBSTRATE</b>	<table style="width: 100%;"> <tr> <td style="width: 50%;"> <b>Odors</b>                  Normal _____ Sewage _____ Petroleum _____                  Chemical _____ Anaerobic _____ None _____                  Other _____                         </td><td style="width: 50%;"> <b>Deposits</b>                  Sludge _____ Sawdust _____ Paper fiber _____ Sand _____                  Relict shells _____ Other _____  <b>Looking at stones which are not deeply embedded, are the undersides black in color?</b>                  Yes _____ No _____                         </td></tr> </table>		<b>Odors</b> Normal _____ Sewage _____ Petroleum _____ Chemical _____ Anaerobic _____ None _____ Other _____	<b>Deposits</b> Sludge _____ Sawdust _____ Paper fiber _____ Sand _____ Relict shells _____ Other _____ <b>Looking at stones which are not deeply embedded, are the undersides black in color?</b> Yes _____ No _____
<b>Odors</b> Normal _____ Sewage _____ Petroleum _____ Chemical _____ Anaerobic _____ None _____ Other _____	<b>Deposits</b> Sludge _____ Sawdust _____ Paper fiber _____ Sand _____ Relict shells _____ Other _____ <b>Looking at stones which are not deeply embedded, are the undersides black in color?</b> Yes _____ No _____			

INORGANIC SUBSTRATE COMPONENTS (should add up to 100%)			ORGANIC SUBSTRATE COMPONENTS (does not necessarily add up to 100%)		
Substrate Type	Diameter	% Composition in Sampling Reach	Substrate Type	Characteristic	% Composition in Sampling Area
Bedrock			Detritus	sticks, wood, coarse plant materials (CPOM)	
Boulder	> 256 mm (10")				
Cobble	64-256 mm (2.5"-10")		Muck-Mud	black, very fine organic (FPOM)	
Gravel	2-64 mm (0.1"-2.5")				
Sand	0.06-2mm (gritty)		Marl	grey, shell fragments	
Silt	0.004-0.06 mm				
Clay	< 0.004 mm (slick)				

# HABITAT ASSESSMENT FIELD DATA SHEET - HG - USE ON ALL STREAMS (FRONT)

STREAM NAME		LOCATION	
STATION # _____ RIVERMILE _____		STREAM CLASS	
LAT _____ LONG _____		RIVER BASIN	
STORET #		AGENCY	
INVESTIGATORS			
FORM COMPLETED BY		DATE _____ TIME _____ AM PM	REASON FOR SURVEY

Parameters to be evaluated in sampling reach	Habitat Parameter	Condition Category			
		Optimal	Suboptimal	Marginal	Poor
	<b>1. Epifaunal Substrate/ Available Cover</b>	Greater than 70% of substrate favorable for epifaunal colonization and fish cover; mix of snags, submerged logs, undercut banks, cobble or other stable habitat and at stage to allow full colonization potential (i.e., logs/snags that are <u>not</u> new fall and <u>not</u> transient).	40-70% mix of stable habitat; well-suited for full colonization potential; adequate habitat for maintenance of populations; presence of additional substrate in the form of newfall, but not yet prepared for colonization (may rate at high end of scale).	20-40% mix of stable habitat; habitat availability less than desirable; substrate frequently disturbed or removed.	Less than 20% stable habitat; lack of habitat is obvious; substrate unstable or lacking.
	<b>SCORE</b>	20 19 18 17 16	15 14 13 12 11	10 9 8 7 6	5 4 3 2 1 0
	<b>2. Embeddedness</b>	Gravel, cobble, and boulder particles are 0-25% surrounded by fine sediment. Layering of cobble provides diversity of niche space.	Gravel, cobble, and boulder particles are 25-50% surrounded by fine sediment.	Gravel, cobble, and boulder particles are 50-75% surrounded by fine sediment.	Gravel, cobble, and boulder particles are more than 75% surrounded by fine sediment.
	<b>SCORE</b>	20 19 18 17 16	15 14 13 12 11	10 9 8 7 6	5 4 3 2 1 0
	<b>3. Velocity/Depth Regime</b>	All four velocity/depth regimes present (slow-deep, slow-shallow, fast-deep, fast-shallow). (Slow is < 0.3 m/s, deep is > 0.5 m.)	Only 3 of the 4 regimes present (if fast-shallow is missing, score lower than if missing other regimes).	Only 2 of the 4 habitat regimes present (if fast-shallow or slow-shallow are missing, score low).	Dominated by 1 velocity/depth regime (usually slow-deep).
	<b>SCORE</b>	20 19 18 17 16	15 14 13 12 11	10 9 8 7 6	5 4 3 2 1 0
	<b>4. Sediment Deposition</b>	Little or no enlargement of islands or point bars and less than 5% of the bottom affected by sediment deposition.	Some new increase in bar formation, mostly from gravel, sand or fine sediment; 5-30% of the bottom affected; slight deposition in pools.	Moderate deposition of new gravel, sand or fine sediment on old and new bars; 30-50% of the bottom affected; sediment deposits at obstructions, constrictions, and bends; moderate deposition of pools prevalent.	Heavy deposits of fine material, increased bar development; more than 50% of the bottom changing frequently; pools almost absent due to substantial sediment deposition.
	<b>SCORE</b>	20 19 18 17 16	15 14 13 12 11	10 9 8 7 6	5 4 3 2 1 0
	<b>5. Channel Flow Status</b>	Water reaches base of both lower banks, and minimal amount of channel substrate is exposed.	Water fills >75% of the available channel; or <25% of channel substrate is exposed.	Water fills 25-75% of the available channel, and/or riffle substrates are mostly exposed.	Very little water in channel and mostly present as standing pools.
	<b>SCORE</b>	20 19 18 17 16	15 14 13 12 11	10 9 8 7 6	5 4 3 2 1 0



# HABITAT ASSESSMENT FIELD DATA SHEET—HIGH GRADIENT STREAMS (BACK)

Habitat Parameter	Condition Category																				
	Optimal					Suboptimal					Marginal					Poor					
<b>6. Channel Alteration</b>	Channelization or dredging absent or minimal; stream with normal pattern.					Some channelization present, usually in areas of bridge abutments; evidence of past channelization, i.e., dredging, (greater than past 20 yr) may be present, but recent channelization is not present.					Channelization may be extensive; embankments or shoring structures present on both banks; and 40 to 80% of stream reach channelized and disrupted.					Banks shored with gabion or cement; over 80% of the stream reach channelized and disrupted. Instream habitat greatly altered or removed entirely.					
<b>SCORE</b>	20	19	18	17	16	15	14	13	12	11	10	9	8	7	6	5	4	3	2	1	0
<b>7. Frequency of Riffles (or bends)</b>	Occurrence of riffles relatively frequent; ratio of distance between riffles divided by width of the stream <7:1 (generally 5 to 7); variety of habitat is key. In streams where riffles are continuous, placement of boulders or other large, natural obstruction is important.					Occurrence of riffles infrequent; distance between riffles divided by the width of the stream is between 7 to 15.					Occasional riffle or bend; bottom contours provide some habitat; distance between riffles divided by the width of the stream is between 15 to 25.					Generally all flat water or shallow riffles; poor habitat; distance between riffles divided by the width of the stream is a ratio of >25.					
<b>SCORE</b>	20	19	18	17	16	15	14	13	12	11	10	9	8	7	6	5	4	3	2	1	0
<b>8. Bank Stability (score each bank)</b>	Banks stable; evidence of erosion or bank failure absent or minimal; little potential for future problems. <5% of bank affected.					Moderately stable; infrequent, small areas of erosion mostly healed over. 5-30% of bank in reach has areas of erosion.					Moderately unstable; 30-60% of bank in reach has areas of erosion; high erosion potential during floods.					Unstable; many eroded areas; "raw" areas frequent along straight sections and bends; obvious bank sloughing; 60-100% of bank has erosional scars.					
Note: determine left or right side by facing downstream.																					
SCORE ____ (LB)	Left Bank	10		9		8	7		6		5	4		3		2	1		0		
SCORE ____ (RB)	Right Bank	10		9		8	7		6		5	4		3		2	1		0		
<b>9. Vegetative Protection (score each bank)</b>	More than 90% of the streambank surfaces and immediate riparian zone covered by native vegetation, including trees, understory shrubs, or nonwoody macrophytes; vegetative disruption through grazing or mowing minimal or not evident; almost all plants allowed to grow naturally.					70-90% of the streambank surfaces covered by native vegetation, but one class of plants is not well-represented; disruption evident but not affecting full plant growth potential to any great extent; more than one-half of the potential plant stubble height remaining.					50-70% of the streambank surfaces covered by vegetation; disruption obvious; patches of bare soil or closely cropped vegetation common; less than one-half of the potential plant stubble height remaining.					Less than 50% of the streambank surfaces covered by vegetation; disruption of streambank vegetation is very high; vegetation has been removed to 5 centimeters or less in average stubble height.					
SCORE ____ (LB)	Left Bank	10		9		8	7		6		5	4		3		2	1		0		
SCORE ____ (RB)	Right Bank	10		9		8	7		6		5	4		3		2	1		0		
<b>10. Riparian Vegetative Zone Width (score each bank riparian zone)</b>	Width of riparian zone >18 meters; human activities (i.e., parking lots, roadbeds, clear-cuts, lawns, or crops) have not impacted zone.					Width of riparian zone 12-18 meters; human activities have impacted zone only minimally.					Width of riparian zone 6-12 meters; human activities have impacted zone a great deal.					Width of riparian zone <6 meters; little or no riparian vegetation due to human activities.					
SCORE ____ (LB)	Left Bank	10		9		8	7		6		5	4		3		2	1		0		
SCORE ____ (RB)	Right Bank	10		9		8	7		6		5	4		3		2	1		0		

Total Score \_\_\_\_\_

## BENTHIC MACROINVERTEBRATE FIELD DATA SHEET

STREAM NAME _____	LOCATION _____	
STATION # _____ RIVERMILE _____	STREAM CLASS _____	
LAT _____ LONG _____	RIVER BASIN _____	
STORET # _____	AGENCY _____	
INVESTIGATORS _____		LOT NUMBER _____
FORM COMPLETED BY _____	DATE _____ TIME _____	REASON FOR SURVEY _____

<b>HABITAT TYPES</b>	<b>Indicate the percentage of each habitat type present</b> Cobble _____% Snags _____% Vegetated Banks _____% Sand _____% Submerged Macrophytes _____% Other ( _____ ) _____%
<b>SAMPLE COLLECTION</b>	<b>Gear used</b> D-frame    kick-net    Other _____  <b>How were the samples collected?</b> wading    from bank    from boat  <b>Indicate the number of jabs/kicks taken in each habitat type.</b> Cobble _____ Snags _____ Vegetated Banks _____ Sand _____ Submerged Macrophytes _____ Other ( _____ ) _____
<b>GENERAL COMMENTS</b>	

### QUALITATIVE LISTING OF AQUATIC BIOTA

**Indicate estimated abundance: 0 = Absent/Not Observed, 1 = Rare, 2 = Common, 3= Abundant, 4 = Dominant**

Periphyton	0	1	2	3	4	Slimes	0	1	2	3	4
Filamentous Algae	0	1	2	3	4	Macroinvertebrates	0	1	2	3	4
Macrophytes	0	1	2	3	4	Fish	0	1	2	3	4

### FIELD OBSERVATIONS OF MACROBENTHOS

**Indicate estimated abundance: 0 = Absent/Not Observed, 1 = Rare (1-3 organisms), 2 = Common (3-9 organisms), 3= Abundant (>10 organisms), 4 = Dominant (>50 organisms)**

Porifera	0	1	2	3	4	Anisoptera	0	1	2	3	4	Chironomidae	0	1	2	3	4
Hydrozoa	0	1	2	3	4	Zygoptera	0	1	2	3	4	Ephemeroptera	0	1	2	3	4
Platyhelminthes	0	1	2	3	4	Hemiptera	0	1	2	3	4	Trichoptera	0	1	2	3	4
Turbellaria	0	1	2	3	4	Coleoptera	0	1	2	3	4	Other	0	1	2	3	4
Hirudinea	0	1	2	3	4	Lepidoptera	0	1	2	3	4						
Oligochaeta	0	1	2	3	4	Sialidae	0	1	2	3	4						
Isopoda	0	1	2	3	4	Corydalidae	0	1	2	3	4						
Amphipoda	0	1	2	3	4	Tipulidae	0	1	2	3	4						
Decapoda	0	1	2	3	4	Empididae	0	1	2	3	4						
Gastropoda	0	1	2	3	4	Simuliidae	0	1	2	3	4						
Bivalvia	0	1	2	3	4	Tabinidae	0	1	2	3	4						
						Culcidae	0	1	2	3	4						



# WOLMAN PEBBLE COUNT FORM

County: Lewis

Stream ID: S-CD16

Stream Name: UNT to Second Big Run

HUC Code:

Basin:

Survey Date: 9/2/2021

Impact 52.7m


Surveyors: AE PL

Impact Reach: 52.7m

Type: Bankfull Channel

PEBBLE COUNT							
Inches	PARTICLE	Millimeters		Particle Count	Total #	Item %	% Cum
	Silt/Clay	< .062	S/C	▲ ▼	70	70.00	70.00
	Very Fine	.062-.125	S A N D	▲ ▼	4	4.00	74.00
	Fine	.125-.25		▲ ▼	0	0.00	74.00
	Medium	.25-.5		▲ ▼	3	3.00	77.00
	Coarse	.50-1.0		▲ ▼	2	2.00	79.00
.04-.08	Very Coarse	1.0-2		▲ ▼	0	0.00	79.00
.08 -.16	Very Fine	2 -4		G R A V E L	▲ ▼	0	0.00
.16 - .22	Fine	4 -5.7	▲ ▼		0	0.00	79.00
.22 - .31	Fine	5.7 - 8	▲ ▼		0	0.00	79.00
.31 - .44	Medium	8 -11.3	▲ ▼		2	2.00	81.00
.44 - .63	Medium	11.3 - 16	▲ ▼		3	3.00	84.00
.63 - .89	Coarse	16 -22.6	▲ ▼		5	5.00	89.00
.89 - 1.26	Coarse	22.6 - 32	▲ ▼		0	0.00	89.00
1.26 - 1.77	Vry Coarse	32 - 45	▲ ▼		4	4.00	93.00
1.77 -2.5	Vry Coarse	45 - 64	▲ ▼		2	2.00	95.00
2.5 - 3.5	Small	64 - 90	C O B B L E		▲ ▼	1	1.00
3.5 - 5.0	Small	90 - 128		▲ ▼	1	1.00	97.00
5.0 - 7.1	Large	128 - 180		▲ ▼	3	3.00	100.00
7.1 - 10.1	Large	180 - 256		▲ ▼	0	0.00	100.00
10.1 - 14.3	Small	256 - 362	B O U L D E R	▲ ▼	0	0.00	100.00
14.3 - 20	Small	362 - 512		▲ ▼	0	0.00	100.00
20 - 40	Medium	512 - 1024		▲ ▼	0	0.00	100.00
40 - 80	Large	1024 -2048		▲ ▼	0	0.00	100.00
80 - 160	Vry Large	2048 -4096		▲ ▼	0	0.00	100.00
	Bedrock		BDRK	▲ ▼	0	0.00	100.00
				Totals:	100		
	Total Tally:						

Bankfull Channel Pebble Count, S-CD16

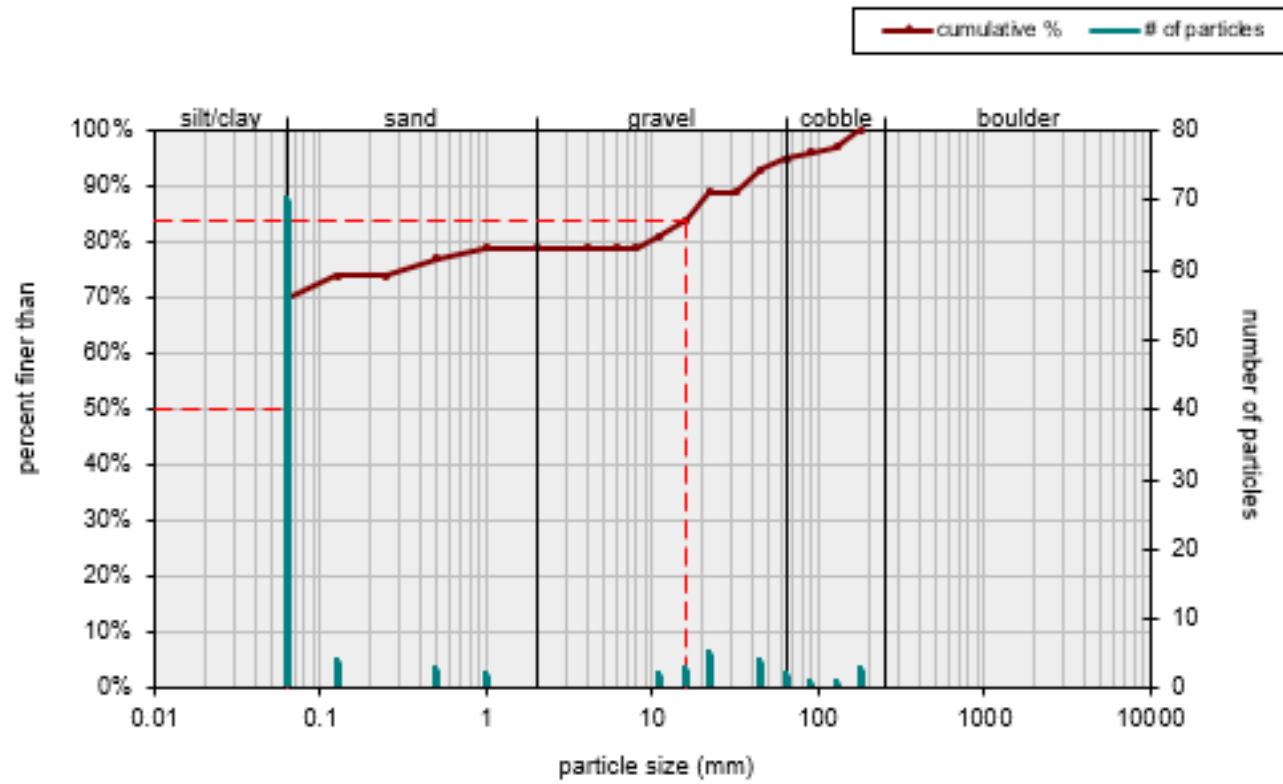


Size (mm)		Size Distribution		Type	
D16	0.062	mean	1.0	silt/clay	70%
D35	0.062	dispersion	129.5	sand	9%
D50	0.062	skewness	0.78	gravel	16%
D65	0.062			cobble	5%
D84	16			boulder	0%
D95	64				






— — — — —	STUDY AREA (EASEMENT)
— — — — —	EXISTING SURVEY-LOCATED THALWEG
<b>1176.87 +</b>	EXISTING SURVEYED GROUND SHOT ELEVATION

1. THIS MAP HAS BEEN ORIENTED TO NAD 1983 UTM ZONE 17N, AND VERTICALLY TO THE NORTH AMERICAN VERTICAL DATUM OF 1988 (NAVD 88), USING REAL TIME DGPS. FIELD LOCATIONS WERE COMPLETED ON SEPTEMBER 02, 2021.
2. EASEMENT LINES SHOWN ON PLAN VIEW WERE PROVIDED BY MOUNTAIN VALLEY PIPELINE.
3. SURVEY POINTS FOR CROSS SECTIONS AND THALWEG PROFILES COLLECTED IN 2021 HAVE BEEN USED IN COMBINATION WITH SURVEY POINTS COLLECTED PREVIOUSLY IN 2020 IN ORDER TO GENERATE THE PRE-CROSSING SURFACE SHOWN IN PLAN. DUE TO NATURAL EROSIONAL STREAM PROCESSES THAT CAN OCCUR OVER TIME, MINOR ADJUSTMENTS TO THE PROFILE ALIGNMENTS MAY HAVE BEEN REQUIRED IN ORDER TO GENERATE A CLEAN PRE-CROSSING SURFACE.
4. ALL SECTION VIEWS SHOWN LEFT TO RIGHT FACING DOWNSTREAM.
5. POST-CROSSING SURVEY INFORMATION SHOWN IN RED. DATA PENDING.
6. POST-CROSSING SURVEY POINTS FOR CROSS SECTIONS AND THALWEG ARE PROJECTED ONTO PRE-CROSSING SECTION AND PROFILE VIEWS FOR COMPARISON.

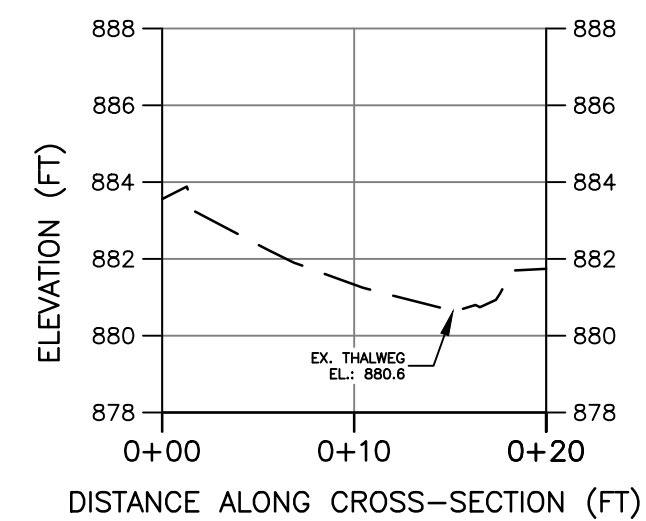

The cross-section profile shows the elevation of the road surface relative to the centerline. The Y-axis represents Elevation (FT) from 876 to 886. The X-axis represents Distance Along Cross-Section (FT) from 0+00 to 0+20. The profile starts at approximately 883.0 FT at 0+00, drops to a minimum of 879.1 FT at 0+10 (labeled 'EX. THALWEG EL.: 879.1'), and then rises to approximately 883.0 FT at 0+20.

Distance Along Cross-Section (FT)	Elevation (FT)
0+00	883.0
0+05	879.5
0+10	879.1
0+15	883.0
0+20	883.0

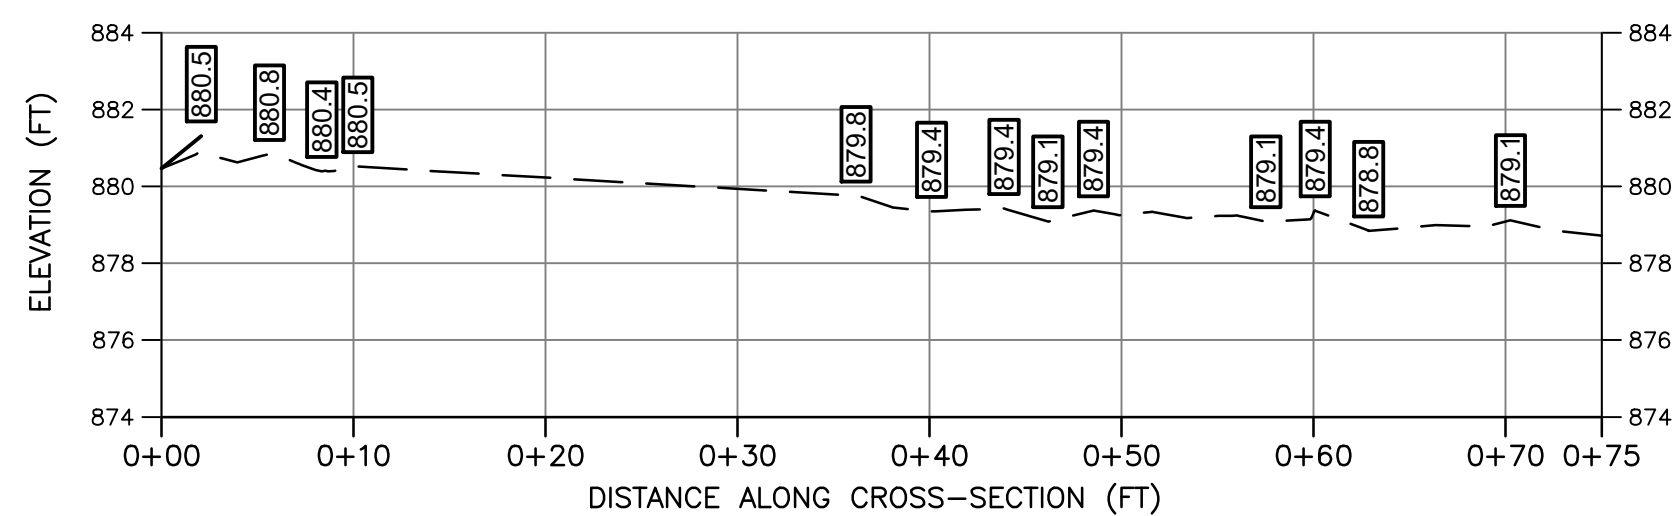

EXISTING STREAM PROFILE  
INVERT ALONG THALWEG

TYPICAL 5-POINT CROSS-SECTION  
(FACING DOWNSTREAM)

TS: TOP OF SLOPE  
BS: BOTTOM OF SLOPE  
THW: THALWEG (INVERT)

AS-BUILT TABLE: 5-CD16 CROSS SECTION B					
PRE-CROSSING			AS-BUILT		
PT. LOC.	NORTHING	EASTING	ELEV	VERT. DIFF.	HORZ. DIFF.
TS-L	14127704.94	1764510.35	883.00		
BS-L	14127705.15	1764509.80	879.58		
THW	14127706.34	1764506.68	879.14		
BS-R	14127707.25	1764504.31	879.57		
TS-R	14127707.92	1764502.56	881.09		

CAD File No.  
 MP  
 Drawn  
 GH  
 Checked  
 DW  
 Approved  
 NOTED  
 Scale:  
 OCT. 2021  
 Date:  
 112IC07157  
 Project No.

**TETRA TECH, INC.**  
661 ANDERSEN DRIVE FOSTER PLAZA 7  
PITTSBURGH, PA 15220  
TEL: (412) 921-7090 FAX: (412) 921-4040  
E-Mail: [info@tetra.com](mailto:info@tetra.com)  
Web: [www.tetra.com](http://www.tetra.com)

**Tt** **TETRA TECH**  
www.tetra.tech.com

NTAIN VALLEY PIPELINE, LLC  
O ENERGY DRIVE, 2ND FLOOR  
CANONSBURG, PA 15317

Profile and Cross-Sections  
Baseline Survey  
Crossing S-CD16 - Unnamed Trib. to  
Second Big Run (MP 61.21)  
Lewis County, WV

1  
Drawing No.

PENDING

PRE-CROSSING PHOTOS



PHOTO TAKEN LOOKING DOWNSTREAM  
FROM UPSTREAM IMPACT LIMITS



PHOTO TAKEN LOOKING UPSTREAM FROM  
DOWNSTREAM IMPACT LIMITS

### POST-CROSSING PHOTOS

PENDING CROSSING

PHOTO TAKEN LOOKING DOWNSTREAM  
FROM UPSTREAM IMPACT LIMITS

PENDING CROSSING

PHOTO TAKEN LOOKING UPSTREAM FROM  
DOWNSTREAM IMPACT LIMITS

PRE-CROSSING

NOTE: ALL SECTIONS VIEWS SHOWN LEFT TO RIGHT FACING DOWNSTREAM.